

**RIDGID
R8654 18V CIRCULAR SAW
REPAIR SHEET**

**RIDGID
FEUILLE DE RÉPARATION
SCIE CIRCULAIRE 18 V R8654**


**RIDGID
SIERRA CIRCULAR DE 18 V R8654
LISTA DE PIEZAS DE REPUESTO**

ONE WORLD TECHNOLOGIES, INC.

P.O. Box 1427

Anderson, SC 29622 USA


1-866-539-1710 ■ www.RIDGID.com

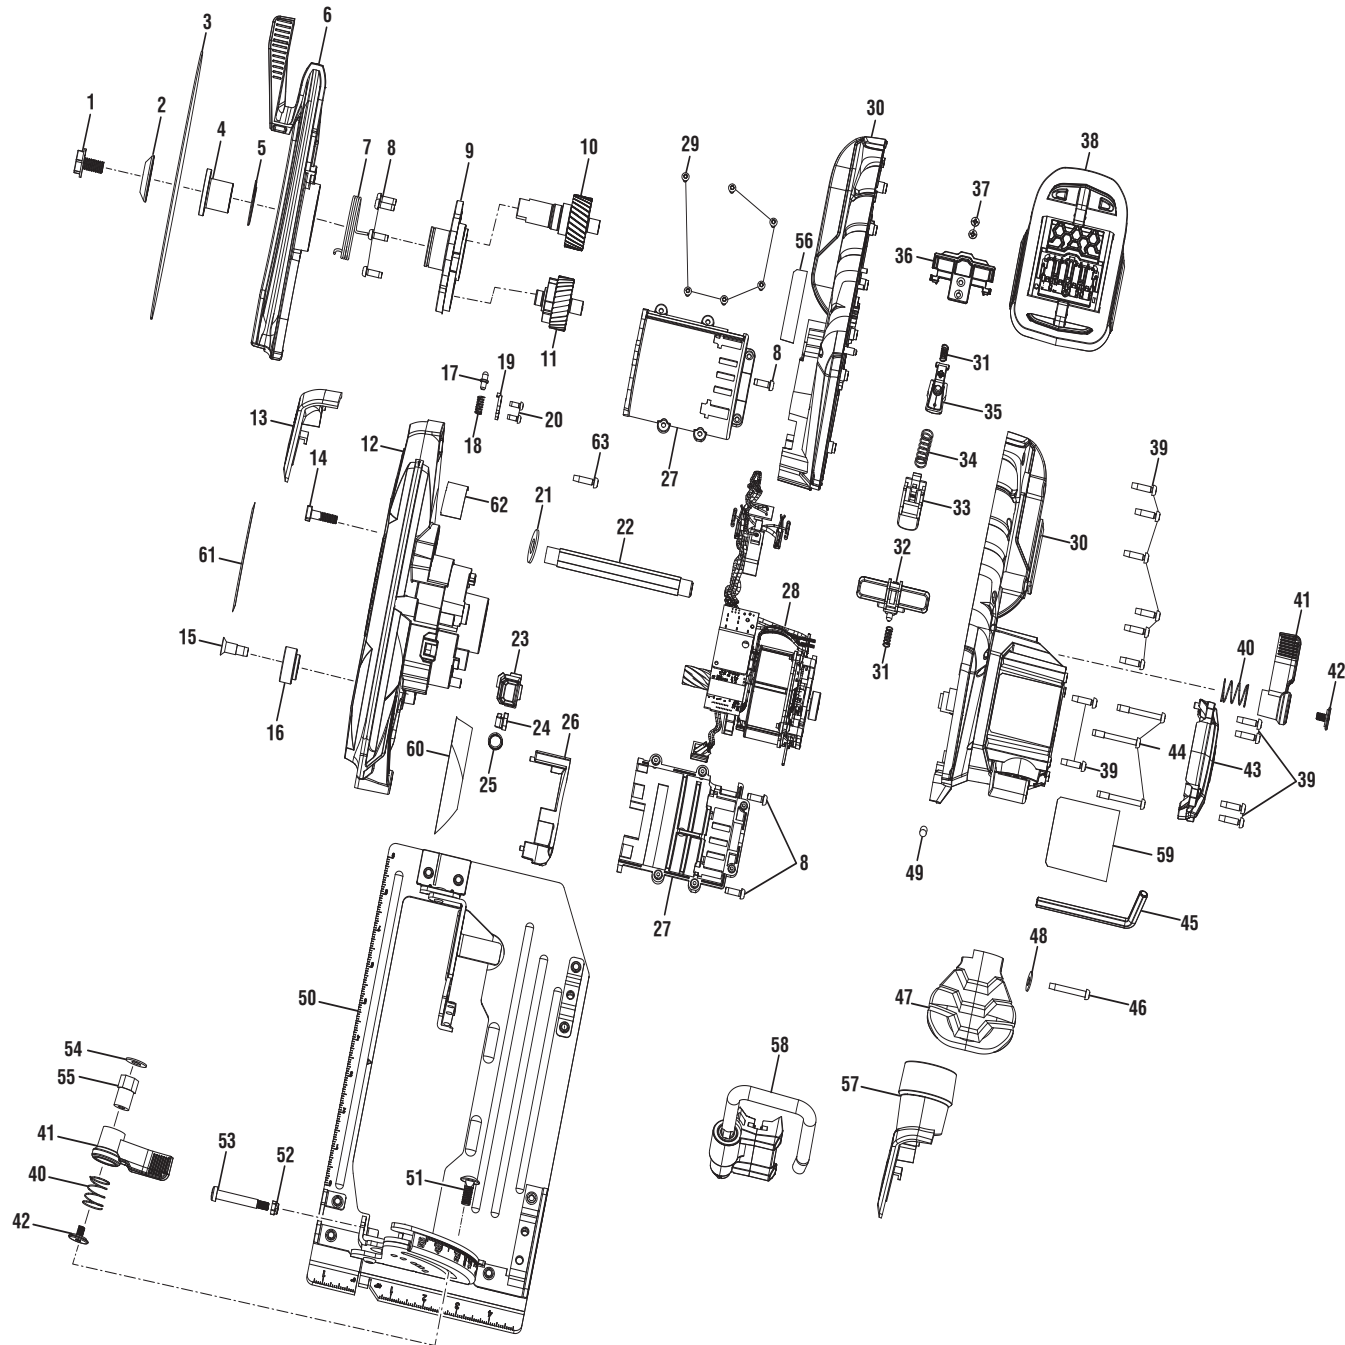



R8654

KEY	P/N	DESCRIPTION	QTY	KEY	P/N	DESCRIPTION	QTY
1	693912001	Blade Screw (5/16-18 x 1/2 in., Hex Soc. Hd.)	1	35	522639002	Light Trigger	1
2	692092001	Outer Blade Washer	1	36	532760001	Battery Cover	1
3	681881006	Saw Blade (7-1/4 in.)	1	37	660204008	Screw (M3 x 10 mm, Flat Hd.)	2
4	697268001	Inner Blade Washer	1	38	360759006	Battery Foot	1
5	696495001	Retaining Ring	1	39	660024044	Screw (M4 x 16 mm, T20 Torx Pan Hd.)	12
6	536494001	Lower Blade Guard	1	40	681035001	Compression Spring	2
7	696636001	Torsion Spring	1	41	366497001	Lever	2
8	660165011	Screw (M4 x 12 mm, T20 Torx Pan Hd.)	7	42	660993001	Screw (1/4-20 x 7 mm, T15 Torx Hd.)	2
9	204881002	Lower Blade Guard Support w/Bearing Assembly	1	43	351347005	End Cap	1
10	206850001	Output Gear w/Shaft Assembly	1	44	661175001	Screw (M4 x 34 mm, T20 Torx Pan Hd.)	3
11	206856001	Middle Gear w/Shaft Assembly	1	45	681945001	Wrench (M6)	1
12	204881003	Upper Blade Guard (Inc. Key Nos. 60-62)	1	46	660024011	Screw (M4 x 28 mm, T20 Torx Pan Hd.)	1
13	537331001	Dust Chute	1	47	527695005	Front Handle	1
14	660865002	Screw (1/4-20 x 3/4 in., Square Hd.)	1	48	680865001	Washer (OD8.5 x ID4.2 x 1t)	1
15	661245001	Screw (M6 x 20 mm, T30 Torx Flat Hd.)	1	49	560219006	Stopper	1
16	561984001	Bumper	1	50	313288003	Base Assembly	1
17	673919001	Detent Pin	1	51	693616001	Carriage Bolt (1/4-20 x 5/8 in.)	1
18	697466001	Compression Spring	1	52	670974002	Lock Nut (M5)	1
19	635962001	Retainer Plate	1	53	660145009	Screw (M5 x 40 mm, T25 Torx Pan Hd.)	1
20	660031015	Screw (M3 x 8 mm, T10 Torx Pan Hd.)	2	54	691142001	Washer (OD15 x ID6.4 x 1.2t)	1
21	635908001	Washer (OD13 x ID6.8 x 1t)	1	55	660841004	Hex Nut (1/4-20)	1
22	672027005	Hexagon Bar	1	56	941120419	Warning Label	1
23	527715001	Spindle Lock Button	1	57	537332001	Vacuum Bag Adaptor	1
24	635410002	Spindle Lock	1	58	314817001	Rafter Hook Assembly	1
25	694163001	Spindle Lock Spring	1	59	941122136	Data Label	1
26	536848001	Baffle	1	60	941114117	Warning Label	1
27	204881004	Motor Housing Assembly	1	61	941120420	Warning Label	1
28	206858001	Motor and Circuit Board Assembly	1	62	941001743	Depth Cut Label	1
29	660570004	Screw (M3 x 14 mm, T10 Torx Pan Hd.)	6	63	661349001	Screw (M4 x 16 mm, Pan Hd.)	1
30	204881005	Handle (Inc. Key Nos. 56 & 59)	1	Not Shown:			
31	672029001	Compression Spring	2	995000738	Operator's Manual (961152985)		
32	536496001	Safety Button	1	3-26-19			
33	536495001	Switch Trigger	1	(Rev:02)			
34	696072001	Compression Spring	1				

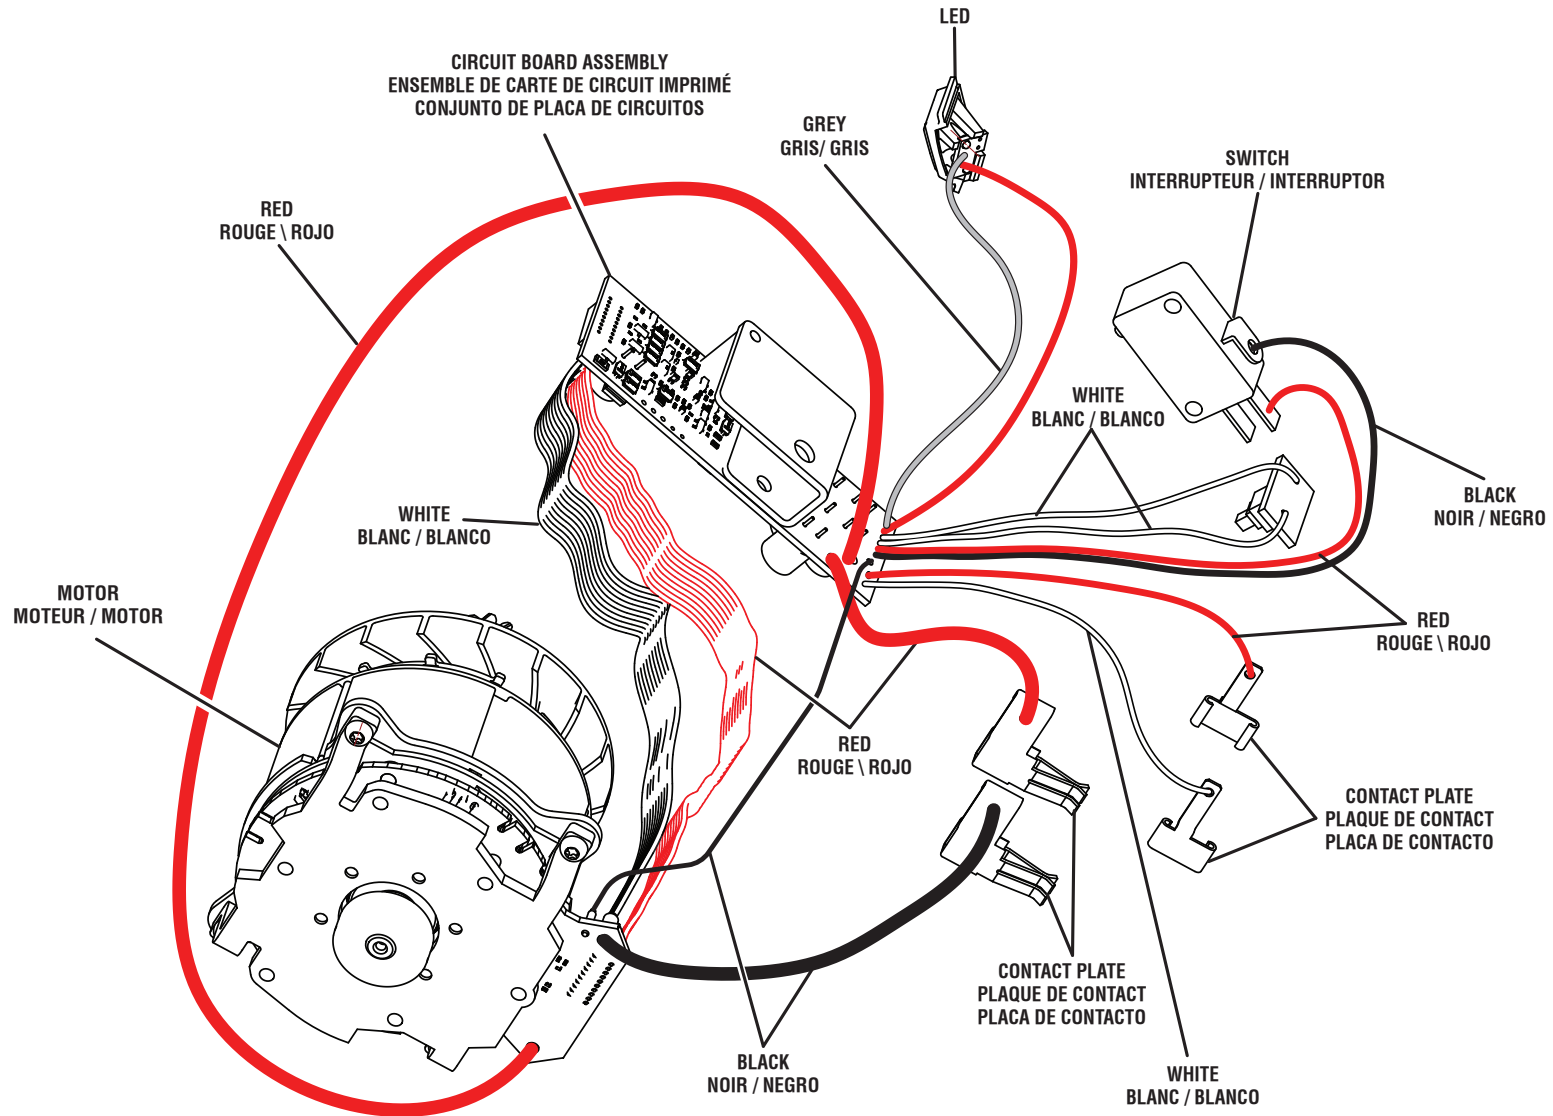

WIRING DIAGRAM
SCHÉMA DE CÂBLAGE
DIAGRAMA DE CABLEADO